


INSTALLATION INSTRUCTIONS:

1. CONDUCTOR SHOULD BE CLEANED, STRAIGHT, IN LAY AND FREE OF BURRS.
2. INSERT CONDUCTOR INTO SPLICE AS FAR AS POSSIBLE. PULL CONDUCTOR BACK FOR INITIAL GRIP.
3. APPLY MOMENTARY TENSION BEFORE RELEASING BLOCKS TO MAKE CERTAIN JAWS ARE "SET" ON CONDUCTOR.

SPLICES AUTOMATIC GUY WIRE, EHS			
CATALOG NUMBER	RANGE	RANGE	DIMENSIONS
	(IN)	(MM)	(A)
GLS5039	.145 – .215	3.86 – 5.45	8.0
GLS5040	.215 – .270	5.46 – 6.86	8.3
GLS5041	.270 – .315	6.86 – 8.00	8.6
GLS5042	.325 – .392	8.26 – 9.96	10.0
GLS5043	.392 – .458	9.96 – 11.63	11.0
GLS5044	.455 – .520	11.56 – 13.21	10.8

DIMENSIONS FOR REFERENCE ONLY

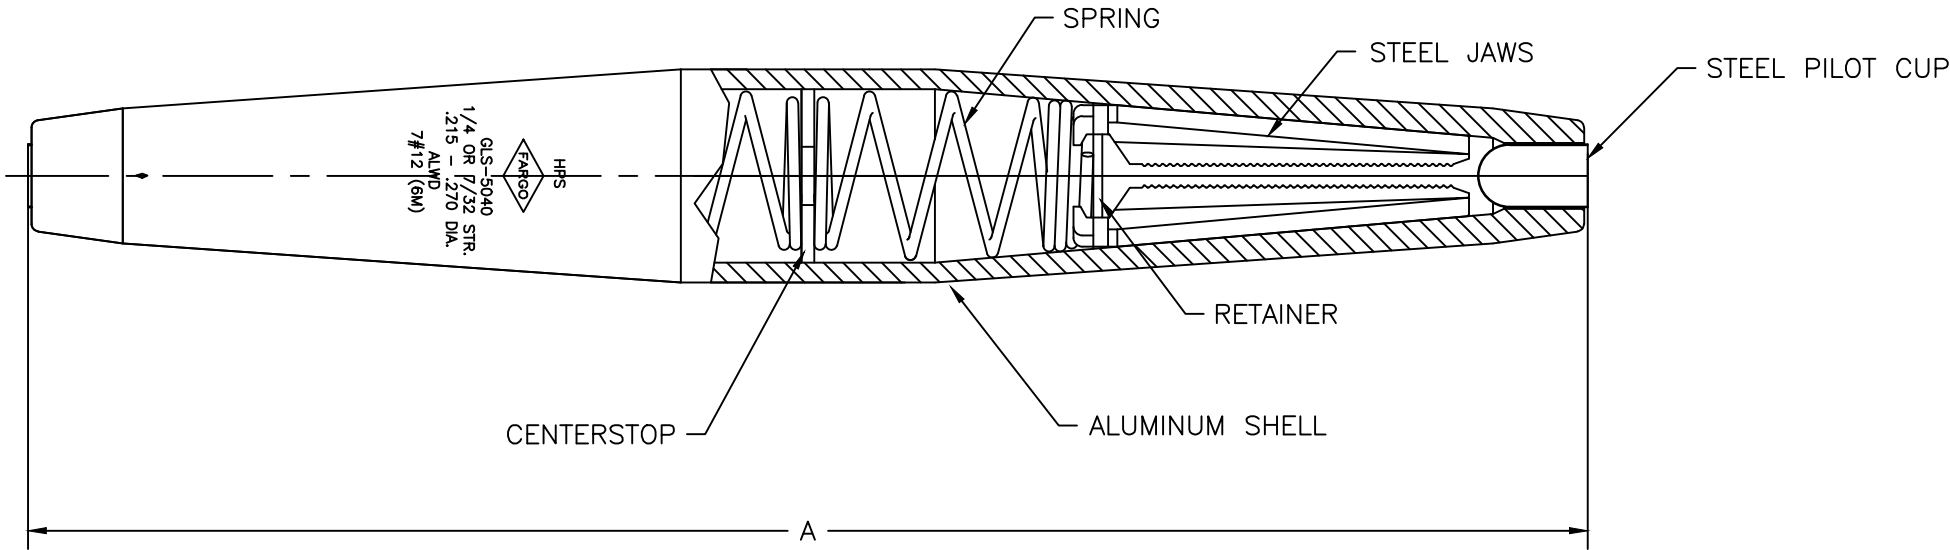

SPLICES AUTOMATIC GUY WIRE, EHS DESCRIPTION					
GLS5039	GLS5040	GLS5041	GLS5042	GLS5043	GLS5044
3/16 STR.	1/4 or 7/32 STR.	5/16 OR 9/32 STR.	3/8 STR.	7/16 STR.	1/2 STR.
.145 – .215 DIA	.215 – .270 DIA.	.270 – .315 DIA.	.325 – .392 DIA	.392 – .458 DIA.	.455 – .520
AW	AW	AW 7#10 (10M)	AW 3#5 7#8 7#9	AW 7#7 (20M), 18M	AW 25M, 7#6
(DATE CODE)	7#12 (6M)	7#11 (8M)	AW 12.5M, 14M & 16M	AWAC #1/0–5/2	#1–2/5, #1/0–3/4, #2/0–5/2
(COUNTRY OF ORIGIN)	(DATE CODE)	(DATE CODE)	AWAC #4–2/5 #2–3/4	AWAC #1–3/4 & #2–2/5	AWAC #2/0–4/3
	(COUNTRY OF ORIGIN)	(COUNTRY OF ORIGIN)	AWAC #1–5/2	(DATE CODE)	(DATE CODE)
			(DATE CODE)	(COUNTRY OF ORIGIN)	(COUNTRY OF ORIGIN)
			(COUNTRY OF ORIGIN)		

55023	3/27/14	JW	JW	FARGO® TOLERANCE CHART		HUBBELL® POWER SYSTEMS			
EC #	DATE	CHG BY	RESP ENG			TITLE GLS 50XX GUY WIRE SPLICE			
DESC OF DWG: ADDED GLS5044 UPDATED FORMAT --- REASON (S) FOR CHANGE: --- DISPOSITION OF MAT'L: ---				CONFIDENTIAL: THIS DRAWING AND ITS CONTENTS ARE CONFIDENTIAL AND THE EXCLUSIVE PROPERTY OF HUBBELL POWER SYSTEMS. NO PUBLICATION, DISTRIBUTION OR COPIES MAY BE MADE WITHOUT THE WRITTEN CONSENT OF HUBBELL POWER SYSTEMS. HUBBELL POWER SYSTEMS UNPUBLISHED ALL RIGHTS RESERVED UNDER THE COPYRIGHT LAWS.		SIZE B	DWG NO. CC-18305	CAT / PART / ASSY NO. GLS 50XX	REV 02
				DO NOT SCALE THIS DRAWING		DRN BY BAF	DATE 06/20/07	SHEET 1 OF 1	